



TECH TIPS

Dixie Part Numbers: S-8774, S-8775

Applications: 1999 – 2000 Hyundai Sonata 2.4L

Condition: The vehicle operator may complain of long cranking time, slow starts or hard cranking, especially after refuelling the vehicle. This condition may also coincide with the vehicle idling rough once started.

Cause: A possible cause for this is a stuck canister purge valve.

Correction: To check the canister purge valve, remove it from the canister (located below the intake surge tank) and try to blow through it. Air should not pass through the valve, if it does the valve needs replacing (part number 39460-38650).

