



TECH TIPS

Dixie Part Numbers: S-8056, S-8160 and S-8399

Applications: 2000 – 2001 Hyundai Accent

Condition: The vehicle operator complains of an intermittent crank no start condition (the frequency of occurrence can be months).

Cause: If the following conditions are true then the cause may be a faulty Engine Control Module:

- Intermittent no start
- The warning lamp on the dash does not light up when the key is turned (normally it should).
- The scan tool can not communicate with the Engine Control Module.
- Disconnecting the battery cable to kill the power “corrects” the problem.
- The vehicle was produced between June 6th, 2000 and July 11th, 2000.

Correction: The manufacture recommends replacing the Engine Control Module with the ones shown in the table below:

Vehicle Model	Engine Control Module Part Number
2001 1.5L Federal and California Specifications	39110-22562
2000 1.5L California Specifications	39110-22561
2000 1.5L Federal Specifications	39110-22551
2001 1.6L Federal and California Specifications	39110-26710

Always follow the manufactures recommended replacement procedures.

