



TECH TIPS

Dixie Part Numbers: S-8378 S-8706 S-8712
S-8773 S-8978

Applications: 1997 – 1999 Infiniti Q45
1999 Infiniti I30
1999 Infiniti QX4
2000 Infiniti G20
2000 Infiniti I30

Condition: Some operators of the above vehicles may complain of intermittent no start conditions.

Cause: A potential cause for this is interference generated by other transponders such as, but not limited to the following:

- A fuel company SpeedPass or Mobil Pass
- Other Infiniti ignition keys
- Other vehicle manufactures transponder style ignition keys

Correction: If the owner of the vehicle has any of the above or similar transponder devices within 2 to 3 cm of the vehicle ignition key (such as on the same key ring) the issue may be present. To correct this the other transponder device simply needs to be moved further away. **NOTE:** Once the vehicle is started the interfering transponder will not cause the engine to stall or the malfunction light to be illuminated.