



TECH TIPS

Dixie Part Numbers: A-80210 A-80308 A-80310 A-80328
 S-8730 S-8772 S-80393 S-80402

Applications: 2006 Lexus GS 300 with Smart Key system
 2006 – 2007 Lexus GS 430 with Smart Key system
 2006 – 2007 Lexus IS 250 with Smart Key system
 2006 – 2007 Lexus IS350 with Smart Key system
 2007 Lexus ES 350 with Smart Key system
 2007 Lexus GS 350 with Smart Key system
 2007 Lexus LS 460 with Smart Key system

Condition: The vehicle may exhibit a no start condition after recharging a dead battery, using the vehicle to jump start another vehicle or after disconnecting the battery to perform service work.

Cause: The steering lock electronic control module may need to be re-initialized.

Correction: The procedure below describes how to perform the re-initialization.

- Ensure that the DCC fuse is installed (during shipping or prolonged storage this is removed to prevent parasitic drains). If the DCC fuse was not removed, remove it and reinstall it.
- Place the shift lever in the “P” position (if not already done).
- Open and close the driver’s side door. This activates the initialization process.
- Depress the break pedal.
- Press the “Start Stop” switch.
- **WARNING!** The above process interrupts the power system and as such all other systems will also require re-initialization. Systems include (but are not limited to):
 - Power windows
 - Parking assistance features
 - Power doors
 - VGRS (steering) system

REV: 20100308 Removed A-80335 and added A-80308