



TECH TIPS

Dixie Part Numbers: A-80032 and S-80319

Applications: 2007 Acura MDX with RES From VIN 2HNYD28—7H500001 through 2HNYD28—7H519033.

Condition: The operator of the vehicle may complain that the battery is dead or low after the tailgate has been left open for an extended period with the engine off.

Cause: A possible cause for the above condition is the Power Tailgate Control Unit, it may leave the system active resulting in a draw of about 3A.

Correction: The vehicle manufacturer recommends that, if the above conditions are found, the Power Tailgate Control Unit be replaced with part number 74970-STX-A02. Follow the manufacturer's recommended procedures for replacing the Power Tailgate Control Unit.

REV: 20100308 A-80337 removed (superseded) A-80032 added.