



# TECH TIPS

**Dixie Part Numbers:** A-8177 A-8197

**Applications:** 1986 – 1987 Acura Integra  
1986 – 1990 Acura Legend

**Condition:** The operator of the vehicle may comment that the charge rate is insufficient and/or that the light flickers at low RPM.

**Cause:** A possible cause for this is excessive current draw at low RPM, particularly noticeable when the vehicle is driven only for short trips as the battery does not have sufficient time to achieve a proper state of charge.

**Correction:** The manufacture suggests in cases where the above is occurring to replace the original alternator pulley and belt with a smaller diameter pulley and corresponding belt. The replacement pulley is 60mm in diameter part number 31141-PL2-004 and the corresponding replacement belt is 31110-PH7-013.

