



# TECH TIPS

Dixie Part Numbers:      A-8265      A-8267

**Applications:**      1991 – 1995 Chrysler Dynasty  
1991 – 1995 Chrysler Daytona  
1991 – 1995 Chrysler LeBaron  
1991 – 1995 Chrysler New Yorker  
1991 – 1995 Chrysler Town & Country  
1991 – 1995 Chrysler Voyager  
1991 – 1995 Dodge Caravan  
1991 – 1995 Dodge Daytona  
1991 – 1995 Dodge Shadow  
1991 – 1995 Dodge Spirit  
1991 – 1995 Dodge Voyager  
1991 – 1995 Plymouth Acclaim  
1991 – 1995 Plymouth Sundance  
1991 – 1995 Plymouth Voyager  
With 2.2l or 2.5L high pressure throttle body fuel injection

**Condition:**      The operator of the vehicle may complain of excessive belt squeal, rough idle, alternator failure and/or battery failures. This will be most prevalent during cool weather (between 0° Celsius and 10° Celsius) or in rainy weather.

**Cause:**      A potential cause for this is a malfunctioning idle control motor (IAC).

**Correction:**      A new IAC part number 4288298 and O-ring should alleviate this problem. *It is vital that a new O-ring be installed with the IAC for proper operation.* Follow the manufacturers recommended procedures for changing the IAC.