



TECH TIPS

Dixie Part Numbers: A-80300 A-80037 A-80308 A-80346
A-80347 A-80348 A-80352 A-80393

Applications: 2007 Lexus ES350
2007 – 2008 Lexus RX 350
2007 – 2008 Toyota Tundra
2008 Toyota Land Cruise
2008 Toyota Sequoia

Condition: The operator of the vehicle may complain of abnormal noise from the drive belt area, drive belt squeaking, or chirping.

Cause: A potential cause for the above conditions could be the belt alignment, belt material, idler pulley and/or the belt tensioner.

Correction: The vehicle manufacturer has made changes to several parts in the accessory drive belt system as shown in the table below by applications.

Model	Changed Part	Reason
Land Cruiser	Tensioner assembly (uses same number but part has been upgraded part number 16620-0S01).	The tensioner assembly has been changed to keep the pulley properly aligned with the other pulleys in the system
ES350 RX350	Idler Pulley, plate and pulley cover (replacement part numbers 16604-0P011, 2 pulleys, and 16649-31020 2 plate/cover kits).	The manufacturer did not detail the reason for the change on this TSB. It is possible that the plate in the kit changes the alignment.
Sequoia Tundra	Accessory drive belt (old number 90916-A2014, new part number 90916-02680)	The accessory drive belt material has been changed to reduce noise.

REV:20101220 Updated part number listing