



TECH TIPS

Dixie Part Numbers: A-9480 A-9526 A-80190 A-80196
 A-80303 S-1466 S-1495 S-1523

Applications: 2005 – 2006 Pontiac Pursuit
 2005 – 2008 Chevrolet Cobalt
 2007 – 2008 Pontiac G5

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- Flickering or non-functioning instrument panel lights
- Parking lights flickering or not functioning
- Tail lights flickering or not functioning
- The trunk open light inoperative
- The radio not functioning
- The door lock not functioning
- The vehicle not starting
- The vehicle not cranking

Cause: A potential cause for the above conditions is the splice connection S361/J361, located on the driver's side at the B pillar, deteriorating, corroding and/or shorting to ground.

Correction: Follow the manufacturer's recommended procedures for inspecting this junction point, which include removing the drivers seat, pulling back the carpeting and inspecting the wiring and performing a water test on the vehicle to ensure water does not pool on the floor.