



TECH TIPS

| | | | | |
|----------------------------|--------|---------|--------|---------|
| Dixie Part Numbers: | A-9461 | A-9462 | A-9463 | A-9464 |
| | A-9471 | A-9472 | A-9479 | A-9480 |
| | A-9534 | A-80384 | S-1466 | S-1495 |
| | S-1497 | S-1502 | S-1523 | S-80280 |
| | TBA | | | |

Applications: 2006 – 2010 Chevrolet Malibu
2006 – 2009 Pontiac G6
2006 – 2009 Saturn Aura

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- The battery is low or discharged
- The engine fails to start or crank
- The vehicle alarm system goes off intermittently
- The door ajar message comes on intermittently (or stays on)
- The interior lights stay on intermittently (or stay on).

The above conditions may be more noticeable in wet/damp weather.

Cause: A potential cause for the above conditions is water seeping into the door-ajar switch, which is integrated in to the door lock assembly. The moisture may result in the switch sending a false signal to the body control module. The body control module would read the false signal and activate the system as if the door was open.

Correction: Follow the manufacturers' recommended diagnostic procedures (which include thoroughly washing the car) to monitor the body control module and door-ajar switches to determine if (and which) switch is the cause of the problem.

