



TECH TIPS

Dixie Part Numbers: A-9378 TBA

Applications: 2008 – 2009 Pontiac G8
2009 – 2012 Chevrolet Corvette
2010 – 2012 Chevrolet Camaro SS

Conditions: The operator of the vehicle may complain that the accessory drive belt squeaks or makes noise.

Cause: A potential cause for the above condition is excessive run out in the crankshaft balancer.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures when applicable, which include measuring the run out on the crankshaft balancer belt grooves and not on the face. Measurements on the face would result in erroneous high readings. The acceptable limit is for the crankshaft balancer run out is 0.4mm. If the belt was squealing or noisy do not reuse it.