



# TECH TIPS


**Dixie Part Numbers:**      A-8245      A-8302      A-8304  
   A-8321      A-8330

**Applications:**      1990 – 1994 Eagle Talon  
   1990 – 1994 Plymouth Laser

**Condition:**      The technician may have problems trouble shooting the charging system.

**Cause:**      A possible cause for this is the generator circuit sub-fusible link (80A) located in the generator circuit.

**Correction:**      Check the generator circuit sub-fusible link located on the right hand side of the engine compartment. See the sketch below for the location of the alternator circuit sub-fusible link.

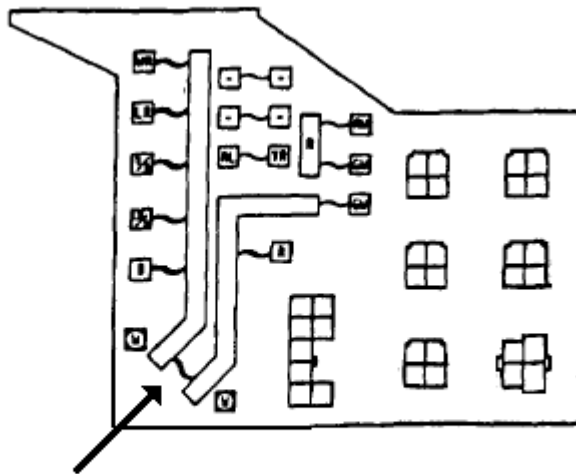

Alternator Circuit  
Sub-fusible link

Revisions: 20090923 Updated wording, added sub-fusible link rating