



TECH TIPS

Dixie Part Numbers:	A-6227	A-6228	A-6229	A-6441
	A-6442	A-6443	S-6100	S-6139
	S-6140	S-6142	S-6143	S-6156
	S-6197	S-6198	S-6199	

Applications: 1996 – 1997 Volkswagen Golf (all options)
1996 – 1997 Volkswagen GTI (all options)
1996 – 1997 Volkswagen Jetta (all options)


Condition: The operator of the vehicle may complain of one or more of the following conditions:

- Repeatedly run down battery.
- Repeated battery failure.
- Repeated alternator failure.
- Hard, long or no-start conditions.
- Repeated starter failure.

Cause: A potential cause for the above conditions is the battery clamps at the battery positive and negative terminals.

Correction: Inspect the battery clamps that attach to the battery posts. If there is no clearance between the jaws disconnect the cables and file 1mm of material so that there is a gap as shown in the sketch on the right.

No Clearance between jaws of the battery clamp

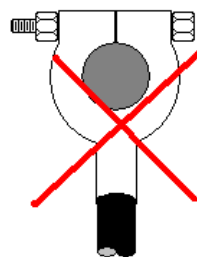

A minimum of 1mm clearance between the jaws of the battery clamp

